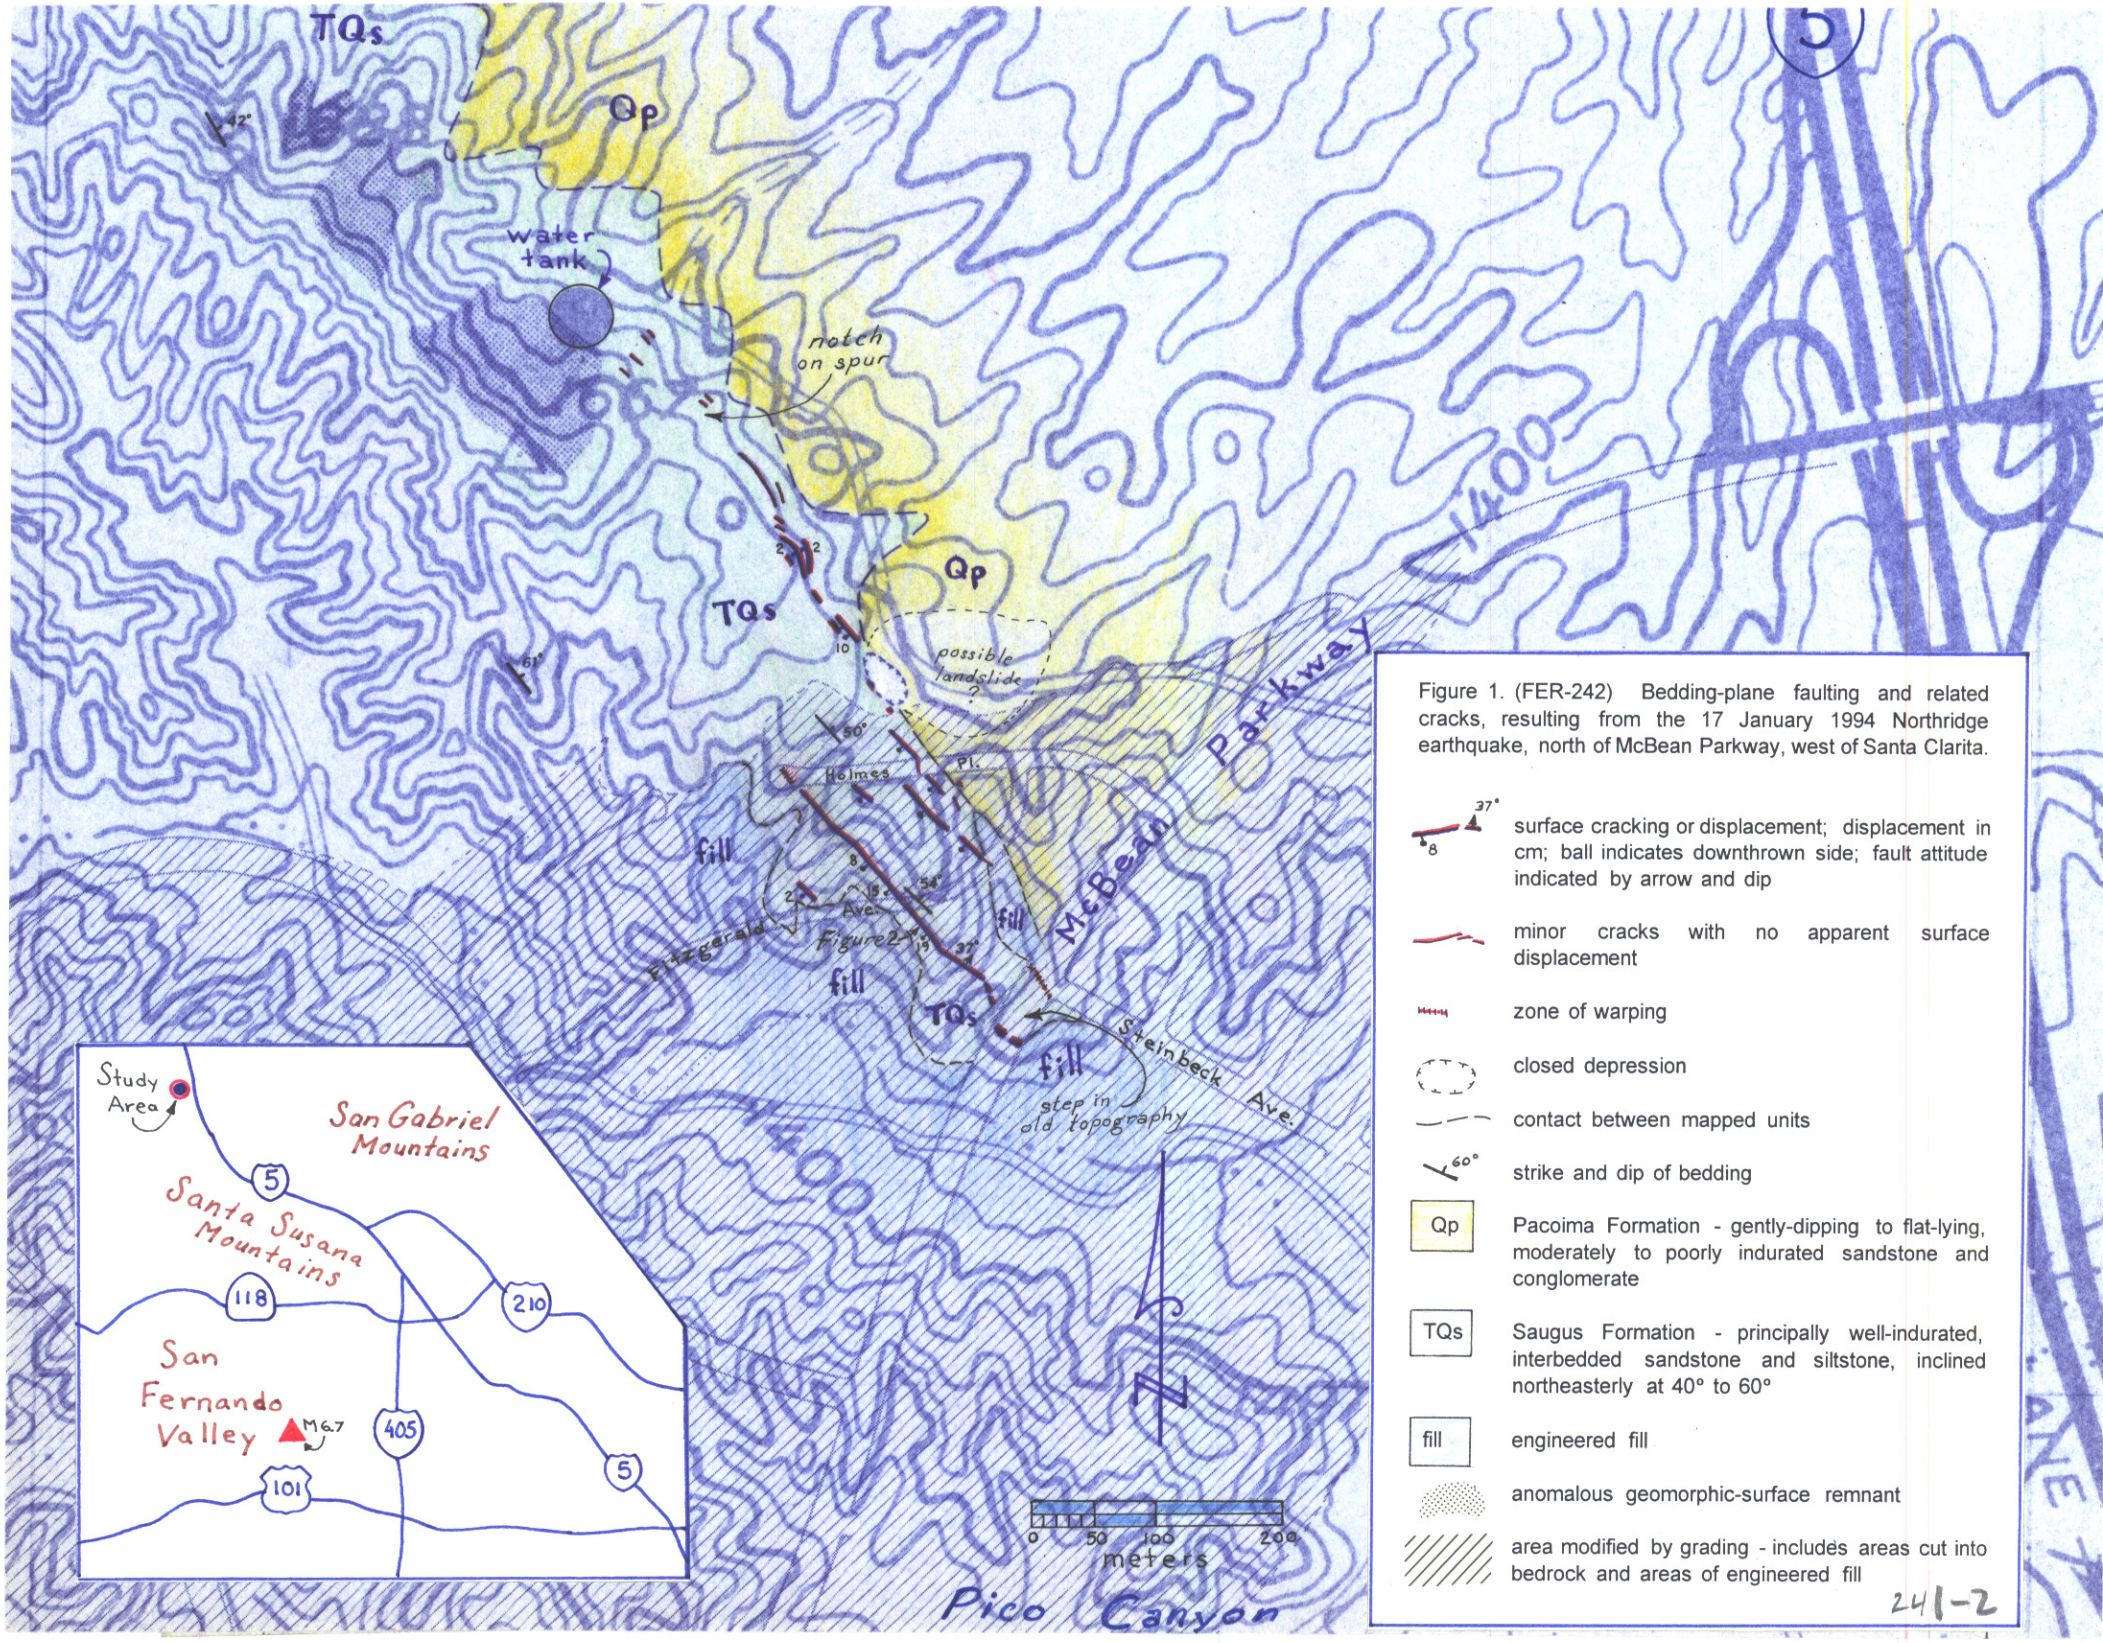
TQs
Qp
water tank
notch on spur
TQs
Qp
possible landslide ?
Holmes
Pl.
McBean Parkway
fill
Fitzgerald Ave.
Figure 2
fill
TQs
fill
Steinbeck Ave.
step in old topography
1400
1300
Pico Canyon
0 50 100 200
meters
Study Area
San Gabriel Mountains
Santa Susana Mountains
San Fernando Valley
M6.7
5
118
210
405
101
5
Figure 1. (FER-242) Bedding-plane faulting and related cracks, resulting from the 17 January 1994 Northridge earthquake, north of McBean Parkway, west of Santa Clarita.
surface cracking or displacement; displacement in cm; ball indicates downthrown side; fault attitude indicated by arrow and dip
minor cracks with no apparent surface displacement
zone of warping
closed depression
contact between mapped units
strike and dip of bedding
Qp
Pacoima Formation - gently-dipping to flat-lying, moderately to poorly indurated sandstone and conglomerate
TQs
Saugus Formation - principally well-indurated, interbedded sandstone and siltstone, inclined northeasterly at 40° to 60°
fill
engineered fill
anomalous geomorphic-surface remnant
area modified by grading - includes areas cut into bedrock and areas of engineered fill
241-2